

Ball-end thrust screws with head stainless steel

Item description/product images



Description


Material:
Stainless steel

Version:
Bright.

Note:
Form A with full ball is used when a clean, polished contact surface is required. Surfaces which are not flat and parallel can be firmly clamped or supported with Form B with flattened ball, the movable ball can adapt itself up to 9°.

Drawing reference:
Form A: with full ball
Form B: with flattened ball

Drawings

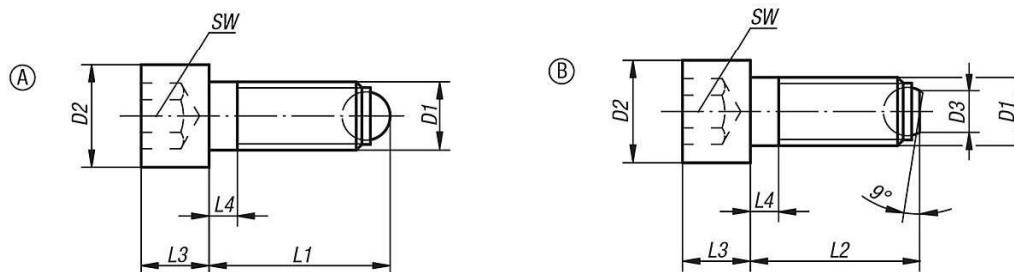

Overview of items

Ball-end thrust screws with head, stainless steel

Order No. Form A	Order No. Form B	D1	D2	D3	L1	L2	L3	L4	Ball Ø	SW
K0381.10410	K0381.20410	M4	7	-/1,4	9,9/-	-/9,7	4	2,1	2,5	3
K0381.10416	K0381.20416	M4	7	-/1,4	15,9/-	-/15,7	4	2,1	2,5	3
K0381.10420	K0381.20420	M4	7	-/1,4	19,9/-	-/19,7	4	2,1	2,5	3
K0381.10512	K0381.20512	M5	8,5	-/2	12,1/-	-/11,7	5	2,4	3	4
K0381.10516	K0381.20516	M5	8,5	-/2	16,1/-	-/15,7	5	2,4	3	4
K0381.10520	K0381.20520	M5	8,5	-/2	20,1/-	-/19,7	5	2,4	3	4
K0381.10620	K0381.20620	M6	10	-/3,2	20,8/-	-/20	6	3	4	5
K0381.10630	K0381.20630	M6	10	-/3,2	30,8/-	-/30	6	3	4	5
K0381.10640	K0381.20640	M6	10	-/3,2	40,8/-	-/40	6	16	4	5
K0381.10820	K0381.20820	M8	13	-/4,5	21,2/-	-/20	8	3,5	5,5	6
K0381.10835	K0381.20835	M8	13	-/4,5	36,2/-	-/35	8	3,5	5,5	6
K0381.10850	K0381.20850	M8	13	-/4,5	51,2/-	-/50	8	22	5,5	6
K0381.11025	K0381.21025	M10	16	-/6	26,7/-	-/25	10	4,5	7	8
K0381.11040	K0381.21040	M10	16	-/6	41,7/-	-/40	10	4,5	7	8
K0381.11060	K0381.21060	M10	16	-/6	61,7/-	-/60	10	28	7	8
K0381.11230	K0381.21230	M12	18	-/7,2	32/-	-/30	12	5	8,5	10
K0381.11250	K0381.21250	M12	18	-/7,2	52/-	-/50	12	5	8,5	10
K0381.11280	K0381.21280	M12	18	-/7,2	82/-	-/80	12	44	8,5	10

Ball-end thrust screws with head stainless steel

Overview of items

Order No. Form A	Order No. Form B	D1	D2	D3	L1	L2	L3	L4	Ball Ø	SW
K0381.11640	K0381.21640	M16	24	-/10,7	43,3/-	-/40	16	6	12	14
K0381.11660	K0381.21660	M16	24	-/10,7	63,3/-	-/60	16	6	12	14
K0381.11680	K0381.21680	M16	24	-/10,7	83,3/-	-/80	16	36	12	14